

Manhole Inspection Summary

Manhole # S290__052MH

Printed On: 5/28/2009

Page 1 of 5

Inspection ☐ Is Incomplete Rating: **3) Fair**

Record Plat: **290** Node: **052** Status: **Found**

Insp Date: **4/14/09 3:08 PM**

Incomplete Comments

Crew: **WJ,DH**
Inspector: **wjenkins**
Firm: **PER**

Location Address: **BEHIND 820 W CROSS ST**

Cross Street: **W HAMBURG ST**

Manhole Type: **Junction**

Location: **Alley**

Ground Conditions: **Wet**

☐ Prev. Rehab

Weather: **Light Rain**

Subject To Ponding: **None**

Comments

Cover

Shape: **Circular**

Diameter: **25.** (in.) Length: **0** (in.) Dist A/B Grade: **0** (in.)
75

Type: **Sanitary**

Condition: **Sound**

Cover Material: **Cast Iron**

Properties: ☐ Bolted ☒ Vented ☐ Water Tight ☐ Water Tight Insert

Frame

Offset: **3** (in.)

Condition: ☐ Sound ☐ Cracked ☒ **Leaks**

Chimney / Frame Adjustment

☒ Exists Material: **Brick**

☐ Parged Height: **5** (in.)

Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☒ **Loose Brick** ☐ Deteriorated

Infiltration: ☐ None ☒ **Joint** ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

Corbel

Material: **Brick**

☐ Parged

Type: **Concentric/Eccentric**

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

Barrel

Material: **Brick**

☐ Parged

Shape: **Circular** Diameter: **48** (in.) Length: **0** (in.)

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

Bench

☒ Exists Material: **Brick**

☐ Parged

Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☒ **Debris**

Channel

Material: **Brick**

☐ Parged

Channel Exposure: **Fully Open** Junc Dist: **0** nearest .5 ft. Azimuth: **0**

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

Steps

Count: **4** Missing: **0** ☒ **Corroded**

Surcharge

☐ Evidence Of Surcharge Depth: **0** (ft.) ☐ Active Surcharge Present

Manhole Inspection Summary

Manhole # S29O__052MH

Printed On: 5/28/2009

Page 2 of 5

Location View



Top View



Miscellaneous



DEBRIS BETWEEN CORRODED RUNGS

Miscellaneous



Cover View

Defect 5



CORRODED RUNGS

Defect 3



DEBRIS ON BENCH

Defect 2



BROKEN LOOSE BRICKS

Defect 1



frame offset; infiltration from chimney joint
& from frame

Manhole Inspection Summary


Manhole # S29O__052MH

Printed On: 5/28/2009

Page 4 of 5

8 in. Circular Gravity Sewer
Pipe Out @ 12 O'Clock

12 O'Clock Outflow

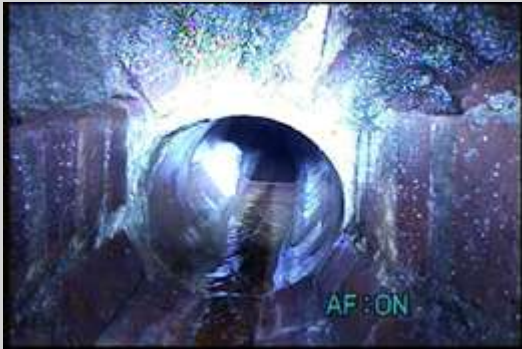

Pipe Height: **8.4** (in.) Rod and Bar (Angled)
Pipe Material: **Clay** ☐ Pipe Lined
Invert Depth: **8.84** (ft.) Flow Characteristics: **Slow**
Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease
Silt Depth: **0** (in.) Deposits Extent:
Infiltration: **None** Pipe Seal Cond: **Sound**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

8 in. Circular Gravity Sewer
Pipe In @ 3 O'Clock

3 O'Clock Inflow



Pipe Height: **8.4** (in.) Rod and Bar (Angled)
Pipe Material: **Clay** ☐ Pipe Lined
Invert Depth: **8.36** (ft.) Flow Characteristics: **Slow**
Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease
Silt Depth: **0** (in.) Deposits Extent:
Infiltration: **None** Pipe Seal Cond: **Sound**

Drop: **None**

Connects To: **Dead End**

☐ Possible Illicit Connection

Manhole Inspection Summary

Manhole # S29O__052MH

Printed On: 5/28/2009

Page 5 of 5

6 in. Circular Gravity Sewer

4 O'Clock Inflow

Pipe In @ 4 O'Clock



Pipe Height: **6** (in.) Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **8.10** (ft.) Flow Characteristics: **None**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: **0** (in.) Deposits Extent:

Infiltration: **None**

Pipe Seal Cond: **Sound**

Drop: **None**

Connects To: **House connection / Service line**

☐ Possible Illicit Connection

8 in. Circular Gravity Sewer

9 O'Clock Inflow

Pipe In @ 9 O'Clock



Pipe Height: **8.4** (in.) Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **8.80** (ft.) Flow Characteristics: **Slow**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: **0** (in.) Deposits Extent:

Infiltration: **None**

Pipe Seal Cond: **Sound**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection